

Processing Guide Secondary Insulation

PG-128 – Dip Polyester Resin





## Processing Guide PG-128 – Dip Polyester Resin Process

Process Step	Optimum	Minimum	Comments
Preheat	1 hour at 135 - 150°C(275 - 300°F) Once unit reaches temperature	None	Relax magnet wire, drives out moisture, thermosets tapes, assists in penetration
Part Temperature when submerged into resin	25 – 30°C (77 - 86°F)	25 – 30°C (77°F – 86°F)	Temperature has a direct bearing on varnish penetration. If too low resin will not penetrate fully. If too high resin can be damaged
Submerge Units	4 inches per minute	Slow as possible	Hold to 10 – 15 minutes or until bubbles cease
Raise units	4 inches per minute	Slow as possible	Slow removal allows good flow
Drain Time	10-15 minutes	None	Longer drain will re- capture more resin.
Cool Resin	Agitate to 18-25°C (65-77°F)	Agitate to 25-27°C (75 - 80°F)	Keeping material cool improves tank life
Bake Schedule	As recommended by product data sheet.	As recommended by product data sheet.	Full cure is required to develop all performance properties.

Please contact ELANTAS PDG, Inc. Technical Service if you have any questions.

Phone number 1.314.621.5700 Extension 717 or 1.800.325.7492 Extension 717

The above properties are typical values and are not intended for specification use.

ELANTAS PDG, Inc. warrants the chemical composition of its products within stated tolerances, but does not guarantee that a product will be appropriate for any particular application. Any recommendation, performance of tests or suggestion is offered merely as a guide and is not a substitute for a thorough evaluation by the manufacturer. No representative of ELANTAS PDG, Inc. has the authority to offer a warranty that a product will perform satisfactorily in manufacturing a product and no such representation should be relied upon.

A member of **WALTANA**